JBL Northridge E90

JBL Loudspeaker Troubleshooting/Repair Tips

Most customers prefer to do simple loudspeaker repairs themselves. By following the steps below, a majority of loudspeakers can be returned to their original factory performance with minimum effort. Choose the example that best describes the problem you are experiencing.

Problem 1: No sound or distorted sound from one loudspeaker in a pair (or set)

Connect the dead/distorting loudspeaker to a different amplifier channel (one that had a functioning loudspeaker connected to it). If it functions normally, the problem is not loudspeaker-related. If the loudspeaker still makes no sound or sounds distorted, a wire may have become loose or disconnected, the network (also known as a crossover) may be defective, the drivers (woofer, tweeter, etc.) may be defective or, in very rare cases, all may be defective.

Refer to the parts list below. The network is a small circuit board found on the inside of the terminal cup, or mounted to an inside wall of the enclosure. It sends low-frequency sounds to the woofer, high-frequency sounds to the tweeter and, if applicable, mid-frequency sounds to the midrange driver. Make sure all wires are secure and connected. Look for components on the network that look burnt, "bulged," or abnormal. If everything looks normal, connect the network to the drivers from another matching loudspeaker. MAKE SURE you attach the correct wires to each driver – mid- and low-frequency sounds can damage the tweeter! If there is still no sound or distorted sound, the network is defective. If there is clean undistorted sound, the drivers are defective.

Problem 2: No sound or distorted sound from one or more (but not all) drivers in an enclosure

Remove the problem driver(s) from the enclosure and make sure all wires are secure and connected. If they are, proceed with the following test: **Woofer or midrange driver –** Connect the driver's + and – input terminals directly to the loudspeaker wires from your receiver/amplifier and play some music at a reasonable volume. If the driver now sounds normal (produces a clean, undistorted sound), the network is most likely defective. **Tweeter –** Replace the tweeter with a functioning tweeter from another loudspeaker. If the tweeter now functions normally (produces clean, undistorted sound), the original tweeter is defective. If the replacement tweeter also sounds distorted or produces no sound, the network is most likely defective.

Problem 3: Loudspeakers distort, rattle or pop at higher volumes

This is usually NOT a loudspeaker problem. Common causes are too much power (playing the loudspeakers too loud and causing them to distort), an amplifier with not enough power (the amplifier can't produce the required volume without distorting), excessive equalization (turning the tone controls too far clockwise, and/or engaging the loudness/bass boost button on your receiver) or some combination of the above. If only one loudspeaker is exhibiting the problem, and you're confident that it's not caused by too little power/too much power/excessive equalization, see solutions for Problems 1 and 2.

М	Model/color	Part number	Descript ion	qty		`			ſ) ——	-11	
1	E90 BK/BE/CH	338035-001	ASY,TWTR,3/4"	1	1,2,3		170	S 11				
2	E90 BK/BE/CH	350354-001	GSKT, TWTR PL-NE SER	1	1,2,3	,4 🕨		6				
	E90		PL,FACE,TWTR-NE SER	1								
3	BK/BE/CH E90	350130-001	BAR,HOLD DOWN-									
4	BK/BE/CH	338059-001	NRTHDGE	1	5,6			11				
	E90							//				
5	BK/BE/CH E90	335588-002	ASY,MIDRNG-N38II/ND31	1				╴╣║				
6	BK/BE/CH	350144-001	RING,TRIM,4",MDRNG,E	1								
7	E90 BK/BE/CH	350139-001	ASY,WFR,8"-NS-W8SBH-	2		/						
/	E90				7 —		(LC)	111				
	BK/BE/CH E90	350140-001	ASY,XOVER-E90 SERIES	1	/ —	14	<u>11</u>	///SII				
9	BK/BE/CH E90	351317-001	T-CUP,BI-WIRE,PLSTC-N	1								
	E90 BK/BE/CH	350132-001	ASY,GRL,FRNT,CAB-E90	1								
12	E90 BK	333249 - 001	CUP,GRL-HLS	8							11	
13	E90BE/BK	333249-003	CUP,GRL-INTRMZO	8					I		11	
15	E90 BK/BE/CH	350426-001	ASY,PTB,-E90/E60	1		- 17	18					
10	E90 BK/BE/CH	338037-001	FT,RUBBER-ASSY/THD IN	4	7 —		"հ∩					
7	E90 BK/BE/CH	339097-001	CAUTION STICKER	1	•	14	1.	<i>#</i> //				
8	E90 BK/BE/CH	350138-001	FOILCAL, E90 SERIES	1				24				
9	E90 BK/BE/CH	350161-001	LBL,JBL"Assem. in Mex	1		_						
					12/1:	3 —		╶╹╢║		◀		
	E90 BK/BE/CH	903401-012	SCR,PB,PPH,#6x.75,BLK	8	15		╎╻┍╴	`` IIII				
	E90 BK/BE/CH	903802-012	SCR,PB,HXS,#8x.75,ZIN	12				//				
	E90	905402-010	SCR,MS,PPH,H/L,6-19X5	2				III		••		
	BK/BE/CH E90									▎▕▏▖▖▎▎		
	BK/BE/CH E90	908302-012	SCR,PB,HXS,#6x.75,ZIN	8	4.4							
	BK/BE/CH	39106S	NAIL, FNSHG, 1"	8	11		┝		I			

Note: A Phillips screwdriver and Allen wrench (hex key) 7/64" and 5/32" sizes are required to service this product